

## SUNROOF MOTOR RESETTING PROCEDURE

### Service Information

If there is ever a need to replace a sunroof motor on the following vehicles:

- 2000-2001 Maxima
- 2000-2001 I30
- 2001 Pathfinder
- 2001 QX4

follow the service procedure below to correctly reset the sunroof and motor.

### Service Procedure

1. Line up the holes in the sunroof linkage to find the "Home" (closed) position (see Figure 1).

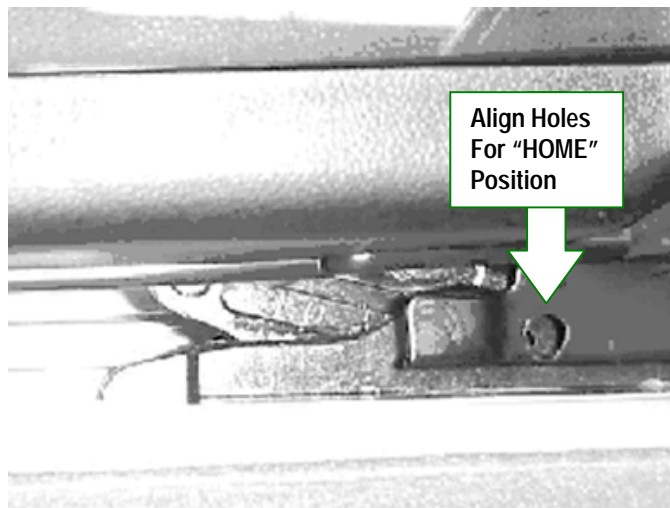


Figure 1

2. Replace the sunroof motor assembly.
3. Disconnect the battery for at least two (2) minutes.
4. Reconnect the battery.

NOTE: Do not use the Auto Open/Close feature for step 5.

5. Cycle the sunroof manually to the full open, then full closed positions.